




NISSENS' TECHNICAL TIPS AC Compressors

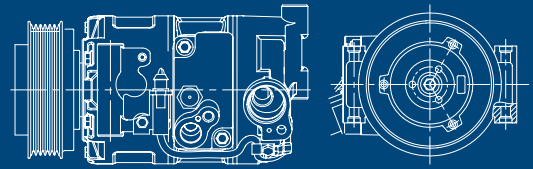

NISSENS NUMBER **89249**

MANUFACTURER VOLVO
MODEL SERIES 850
MODEL ALL MODELS
YEAR 1993-1999

PRODUCT SUBJECT CLUTCH PROBLEMS

Most Volvo 850 models have problems with the clutch after a certain timeframe. The shims that ensure the distance between the hub and the pulley start to create problems. The distance increases over time, and the magnet will at the end not be able to engage the hub properly.

When the clutch is cold, there will be no problems. But once the pulley gets warm (after 2-5 minutes), the hub will disengage due to the increased distance.

